



Wira House, West Park Ring Road,  
Leeds, LS16 6QL, UK.  
Telephone: +44 (0)113 259 1999  
Email: [info@bttg.co.uk](mailto:info@bttg.co.uk)  
Website: [www.bttg.co.uk](http://www.bttg.co.uk)

Date: 25 April 2019

**Our Ref:** 56234-3  
**Your Ref:** 2055

Page: 1 of 3

**Client:** Kobefab International B.V.  
De Vest 62  
5555 XP Valkenswaard  
Netherlands

**Job Title:** Surface Ignition Of Curtains & Drapes (Type B)

**Client's Order No:** 2055

**Date of Receipt:** 01 April 2019

**Date of Test Start:** 23 April 2019

**Description of Sample(s):** One sample identified as follows was received for testing:

Tour FR, stated to be 100% Pes FR

**Work Requested:** We were asked to make the following test:

BS 5867: Part 2: 2008 (2015): Type B Curtains, Drapes and Blinds



Date: 25 April 2019

Our Ref: 56234-3  
Your Ref: 2055

Page: 2 of 3

**Kobefab International B.V.**

Sample was identified as follows:

Tour FR, stated to be 100% Pes FR

BS 5867: Part 2: 2008 (2015): Type B Curtains, Drapes and Blinds

Pre-treatment

No pre-treatment as this fabric is stated to be inherently flame retardant. BS 5867-2 Clause 6.3 states 'All fabrics shall be tested prior to any cleansing procedure. Except where specified that testing after an approved cleansing or wetting procedure is unnecessary.'

Conditioning

The test specimens were conditioned for at least 24 hours in the standard atmosphere of  $60 \pm 5$  % relative humidity (R.H.) and  $20 \pm 2$  °C.


Testing

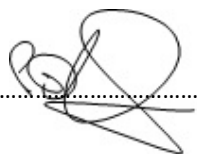
Three specimens from both length and width were tested in accordance with BS EN ISO 15025: Procedure A (surface ignition):2002. The sample was tested at 29°C and 43% relative humidity (R.H.).

Each specimen was subjected to an applied flame using butane and a 15 second flame application time. The results obtained (shown in the table below) were assessed according to the requirements of BS 5867: Part 2:2008 (2015).

Test results relate only to the sample tested.

The results for all tests are given in the table(s) on the following page(s).

Reported by:   
B Bland  
Laboratory Technician

Countersigned By:   
P Doherty  
Manager

Enquiries concerning this report should be addressed to Customer Services

Date: 25 April 2019

Our Ref: 56234-3  
Your Ref: 2055

Page: 3 of 3

**Kobefab International B.V.**

## RESULTS

Sample Ref: Tour FR, stated to be 100% Pes FR

BS 5867: Part 2: 2008 (2015): Type B Curtains, Drapes and Blinds

Testing as received.

| Specimen No.             | Length |    |    | Width |    |    |
|--------------------------|--------|----|----|-------|----|----|
|                          | 1      | 2  | 3  | 4     | 5  | 6  |
| Flame reached an edge    | No     | No | No | No    | No | No |
| Hole reached an edge     | No     | No | No | No    | No | No |
| Flaming debris separated | No     | No | No | No    | No | No |

## Requirements

Any "Yes" means fail except if only one specimen fails a further 6 specimens are tested, if the second 6 specimens all pass the result is a pass.

Result: Pass

## Conclusion

The fabric meets the Type B performance requirements of BS 5867: Part 2: 2008.

The material should be identified with the manufacturers name, trademark or other identifying mark, the statement 'Flammability complies with the requirements of BS 5867: Part 2, Type B and instructions of any special precautions to be taken concerning care (including cleansing) of the curtain, drape or window blind to be manufactured from the fabric, preferably using an appropriate care labelling symbol in accordance with BS EN 23758 and taking account of the pre-treatment used in this test and the requirements of Clause 4 of BS 5867: Part 2: 2008 (2011). If the fabric is unsuitable for cleansing, this shall be stated.

Note: This report relates only to the samples submitted and as described in the report.

## Uncertainty Budget

There is no uncertainty budget associated with BS 5867: Part 2: Type B as no measurements are determined, the pass/fail criteria is assessed visually.